

SONY

SERVICE BULLETIN

No. TC-202

SUBJECT: Reel Cap Coming Off.
SUJET: Le chapeau de bobine se dégage.

DATE: January 30, 1979 **MODEL(S):** TC-K96R

English:

If the reel caps come loose due to insufficient pressure with the reel table, it is necessary to replace both Reel Table and Reel Cap with modified versions.

Both Take-up and Supply reel Tables should be replaced together; the reel stoppers can be re-used, but supply and take-up reel stoppers should not be switched.

Français:

Si les chapeaux de bobine se sont dégagés à cause de pression insuffisante avec le plateau de bobine, il est nécessaire de remplacer le plateau de bobine ainsi que le chapeau de bobine par des types modifiés.

Les plateaux de la bobine réceptrice et débitrice doivent être remplacés ensembles. Les pièces d'arrêt peuvent être ré-utilisées, mais les pièces d'arrêt de la bobine débitrice et réceptrice ne doivent pas être confondues.

Description Nom	Old Part Number No de pièce ancien	New Part Number No de pièce nouveau
Reel Cap Chapeau de bobine	3-538-053-00	3-558-482-00
Reel Table Plateau de bobine	3-558-372-00	X-3558-339-0
Reel Clamp, left(black) Pièce d'arrêt, côté gauch (noire)	3-531-760-00	unchanged inchangé
Reel clamp, right(grey) Pièce d'arrêt, côté droit (grise)	3-558-339-00	unchanged inchangé

